

## **Service Bulletin for AVT 100/150/275 Static Problem/Dead OD Channel**

The problem with overdrive channel failures on the early production runs of AVT 100/150/275's has been identified as being caused by static discharge through the amplifier's input jack socket. An RFC (request for change) procedure has been implemented which will see the fitting of two small zener diodes on the input jack socket boards of these models, which will serve to clamp the static discharge potential to a low, non-destructive level. This will eliminate the present problem. Please view the Static mod schematic on the next page for the correct placement of the two zener diodes.