



## TECH NOTES

FENDER MUSICAL INSTRUMENTS CORP.  
7975 N. HAYDEN ROAD  
SCOTTSDALE, ARIZONA 85258

98



# M-80

## BIAS MODIFICATION

An engineering change notice has been issued requiring a resistor change in the Power amp section of the M-80. This was necessary to reduce the DC Bias current through the output transistors. The resistor change will minimize the possibility of the power amp overheating, thus improving reliability.

Product recall is unnecessary, but any M-80 in for service should have this change performed.

Remove R74 & R76 ( $1K\Omega$  1/4watt) and replace with a  $2.2K\Omega$  1/4watt Carbon Film Resistor (P/N 024971)

JUNE 1993