

A Division of St. Louis Music, Inc

11880 Borman Dr

St. Louis, MO 63146

Phone 314 569 0141

Service Department

Phone 800 738 7563

Fax 314 567 7278

Customer Service Bulletin

January, 1997

Units Affected:

<u>Model</u>	<u>Serial Number</u>	<u>Model</u>	<u>Serial Number</u>
SVT-CL	prior to TCLDJ10001	SVT-2PRO	prior to T2PDJ10001
SVT-CLJ	prior to TCLJJ10001	SVT-2PROJ	prior to T2PJJ10001
SVT-CLW	prior to TCLWJ10001	SVT-2PROW	prior to T2PWJ10001


Concern:

Some units may unnecessarily trip the protection circuitry and cause the unit to go into "fault" mode (i.e. flashing red and green power LED).

Corrective Action:

Install a .1 mfd/50V capacitor (part # 10A104-01) on the power amp board, as shown below.

Note: This Customer Service Bulletin (CSB) should be done in addition to the one released in March 1995 which added back to back diodes to the power amp input and also changed the gain resistor (R1 audio output PCB) to a 68K 1/4W. For reference the diodes are shown on the figure below. All future runs of these models will incorporate this update.

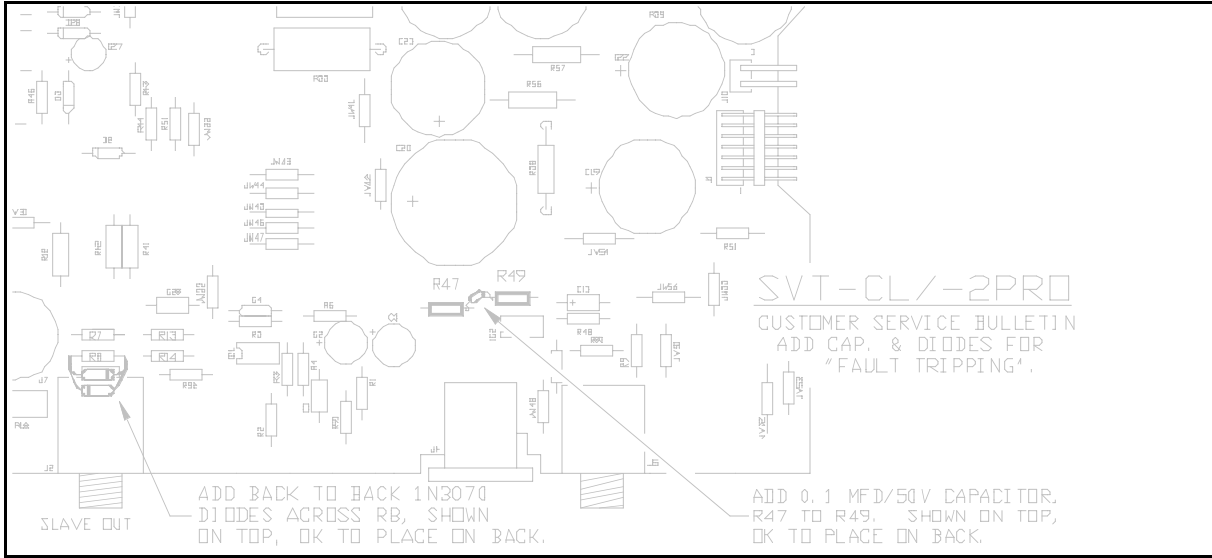

SVT-CL/-2PRO

CUSTOMER SERVICE BULLETIN
 ADD CAP. & DIODES FOR
 "FAULT TRIPPING".

SLAVE OUT

ADD BACK TO BACK 1N3070
 DIODES ACROSS RB, SHOWN
 ON TOP, OK TO PLACE ON BACK.

ADD 0.1 MFD/50V CAPACITOR,
 R47 TO R49. SHOWN ON TOP,
 OK TO PLACE ON BACK.