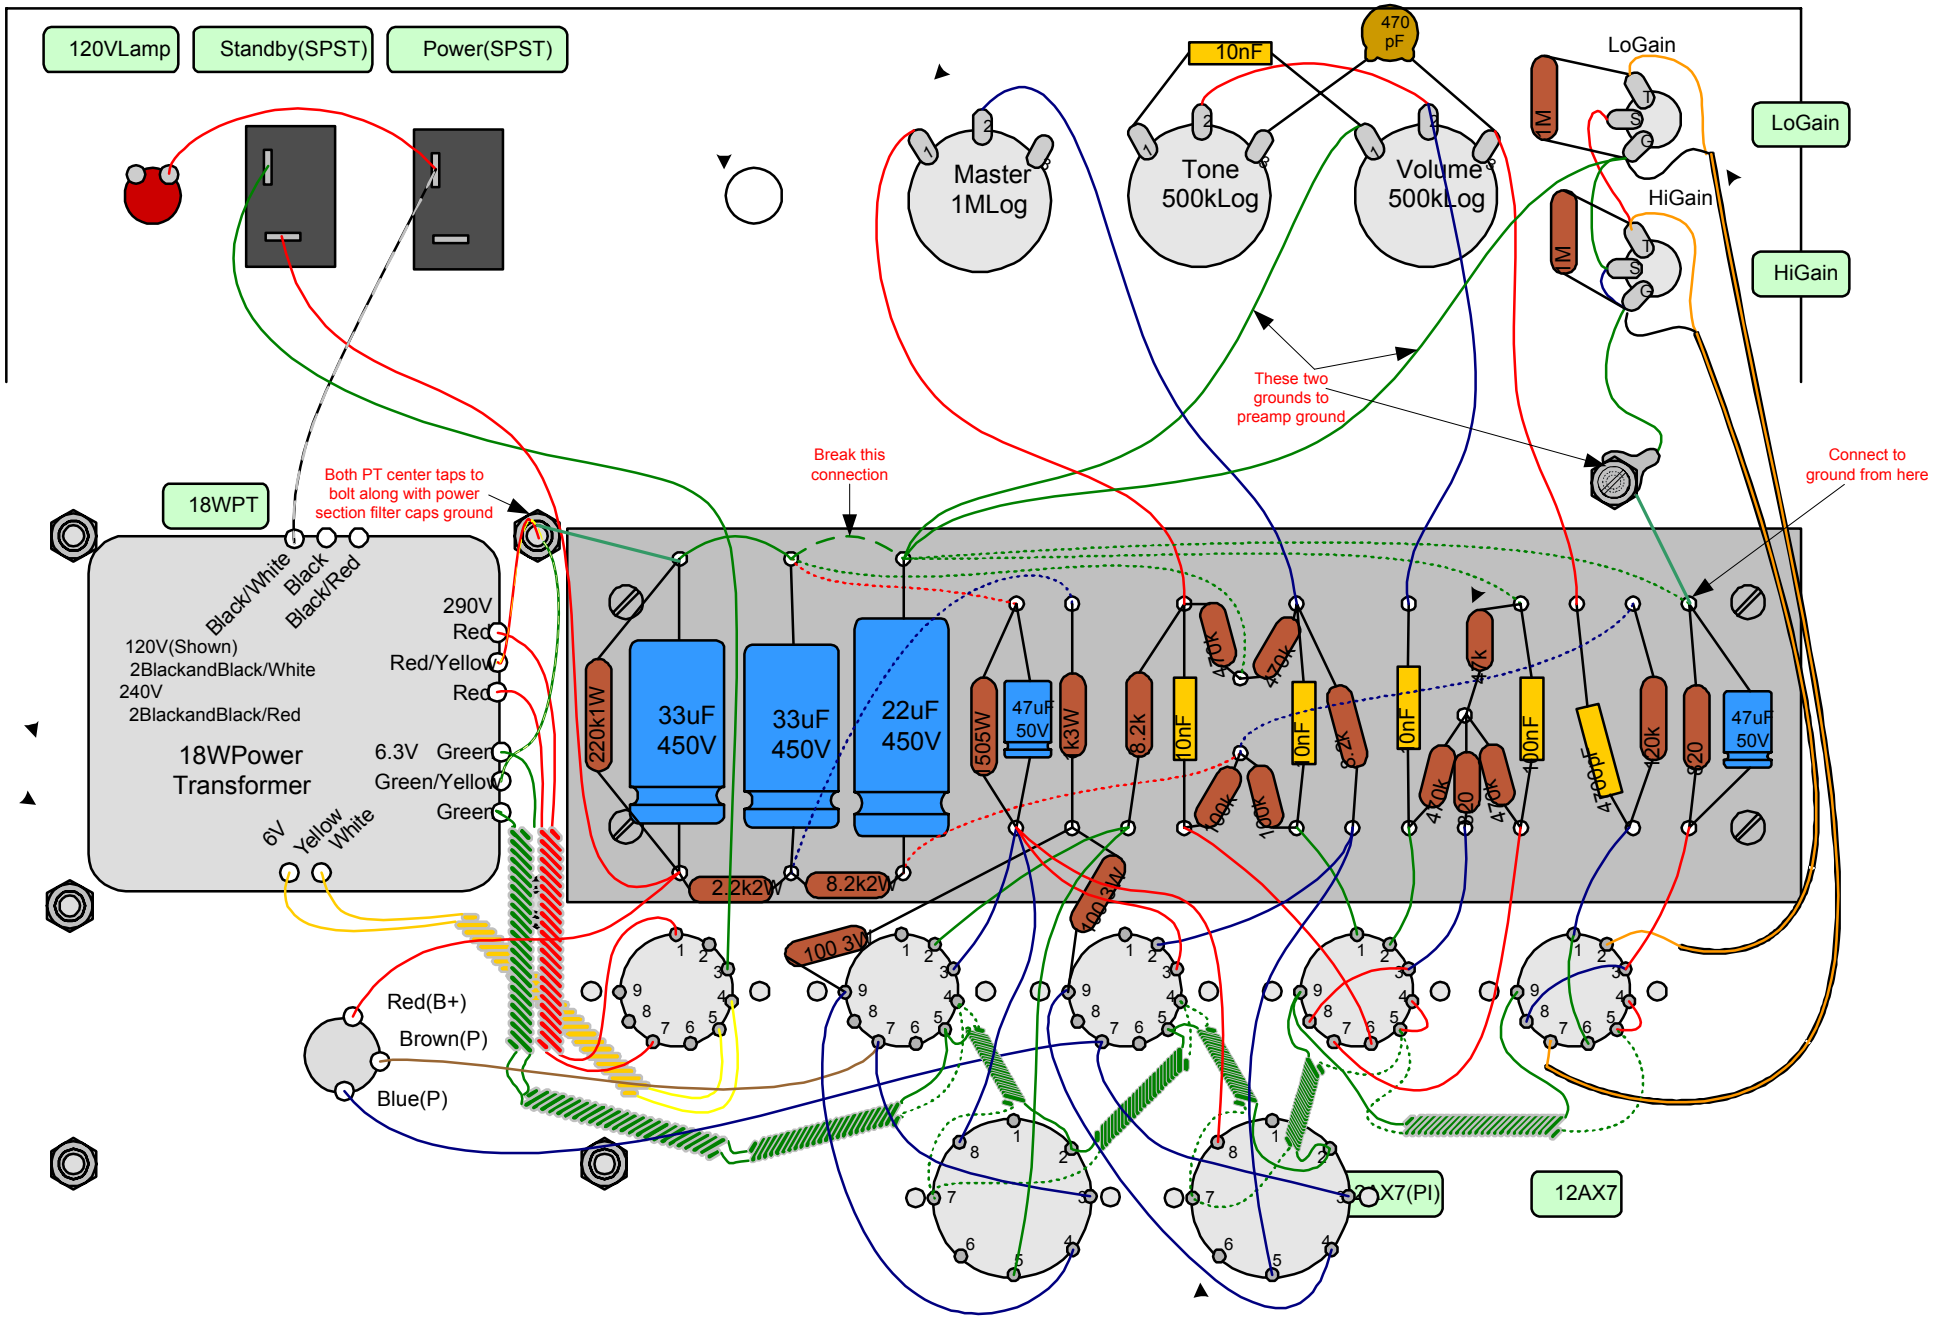
120VLamp
Standby(SPST)
Power(SPST)
Master
1MLog
Tone
500kLog
Volume
500kLog
10nF
470
pF
LoGain
HiGain
1M
These two
grounds to
preamp ground
Break this
connection
Both PT center taps to
bolt along with power
section filter caps ground
Connect to
ground from here
18WPT
Black/White
Black
Black/Red
120V(Shown)
2BlackandBlack/White
240V
2BlackandBlack/Red
18WPower
Transformer
290V
Red
Red/Yellow
Red
6.3V
Green
Green/Yellow
Green
6V
Yellow
White
220k1W
33uF
450V
33uF
450V
22uF
450V
505W
47uF
50V
1k3W
8.2k
10nF
470k
470k
10nF
6.2k
10nF
470k
820
470k
100nF
4700pF
120k
820
47uF
50V
2.2k2W
8.2k2W
100k
100k
100 3W
100 3W
Red(B+)
Brown(P)
Blue(P)
12AX7(PI)
12AX7
6V6/EL84OutputSectionNotes