



ET-7 (151-007) PCB-(less parts 052-199) JC-120 serial NO. 543650 and higher
JC-160 serial NO. 541050 and higher

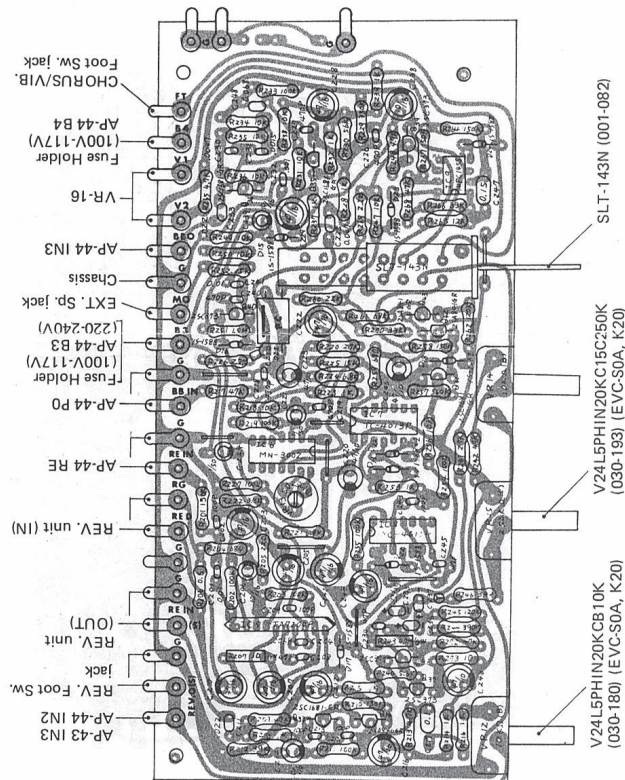

AP-44 parts modification					
JC-120 522850 JC-160 520950	Q16, Q17, Q19 25K30A(GR) → 25K30A(Y)	R101 47K → 82K	R134 4.7K → 5.6K	R108 3.3K → 8.2K	C135 0.0047μf → 0.001μf
JC-120 543650 JC-160 541050	C117 100μf 50V → 470μf 35V				
JC-120 564200 JC-160 561100	R142, R145, R146, R148, R151 1/4R → fusing resistor	R116, R149 1/4W → 1/2W			
ET-7 parts modification					
JC-120 522850 JC-160 520950	R266 39K → 33K				
JC-120 543650 JC-160 541050	pc board 052-190A → 052-199	C240 0.0022μf → 470pf			
JC-120 574500 JC-160 571250	D21 1S1588 → omitted	C250 0 → 0.022μf	C238 100μf 6.3V → 10μf 16V		

OVERALL CIRCUIT DIAGRAM
JC-120 serial No. 512500 and higher
JC-160 serial No. 510850 and higher

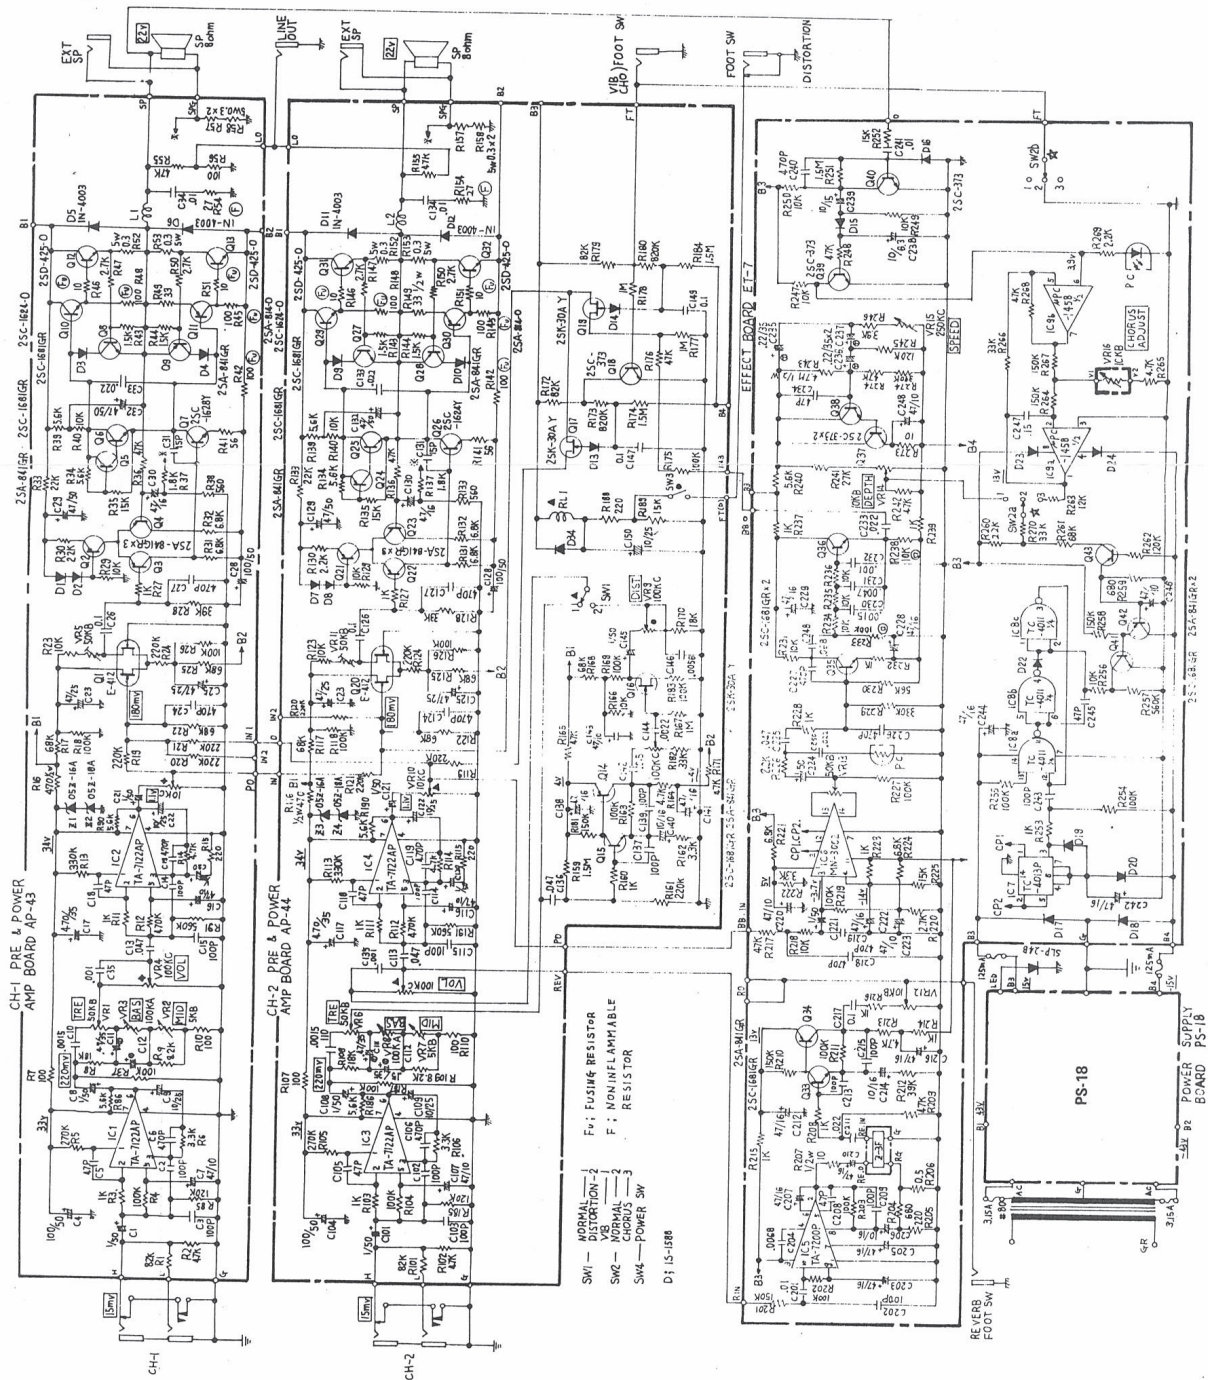

CORRECTION SHEET

The patterns of PS-19 on page 4 and PS-18 on page 8 are printed upside down. Please attach the followings to corresponding parts.

