


Traynor YCV40 - Presence Knob to master volume mod
 with reverb working correctly.

For early 2000's models

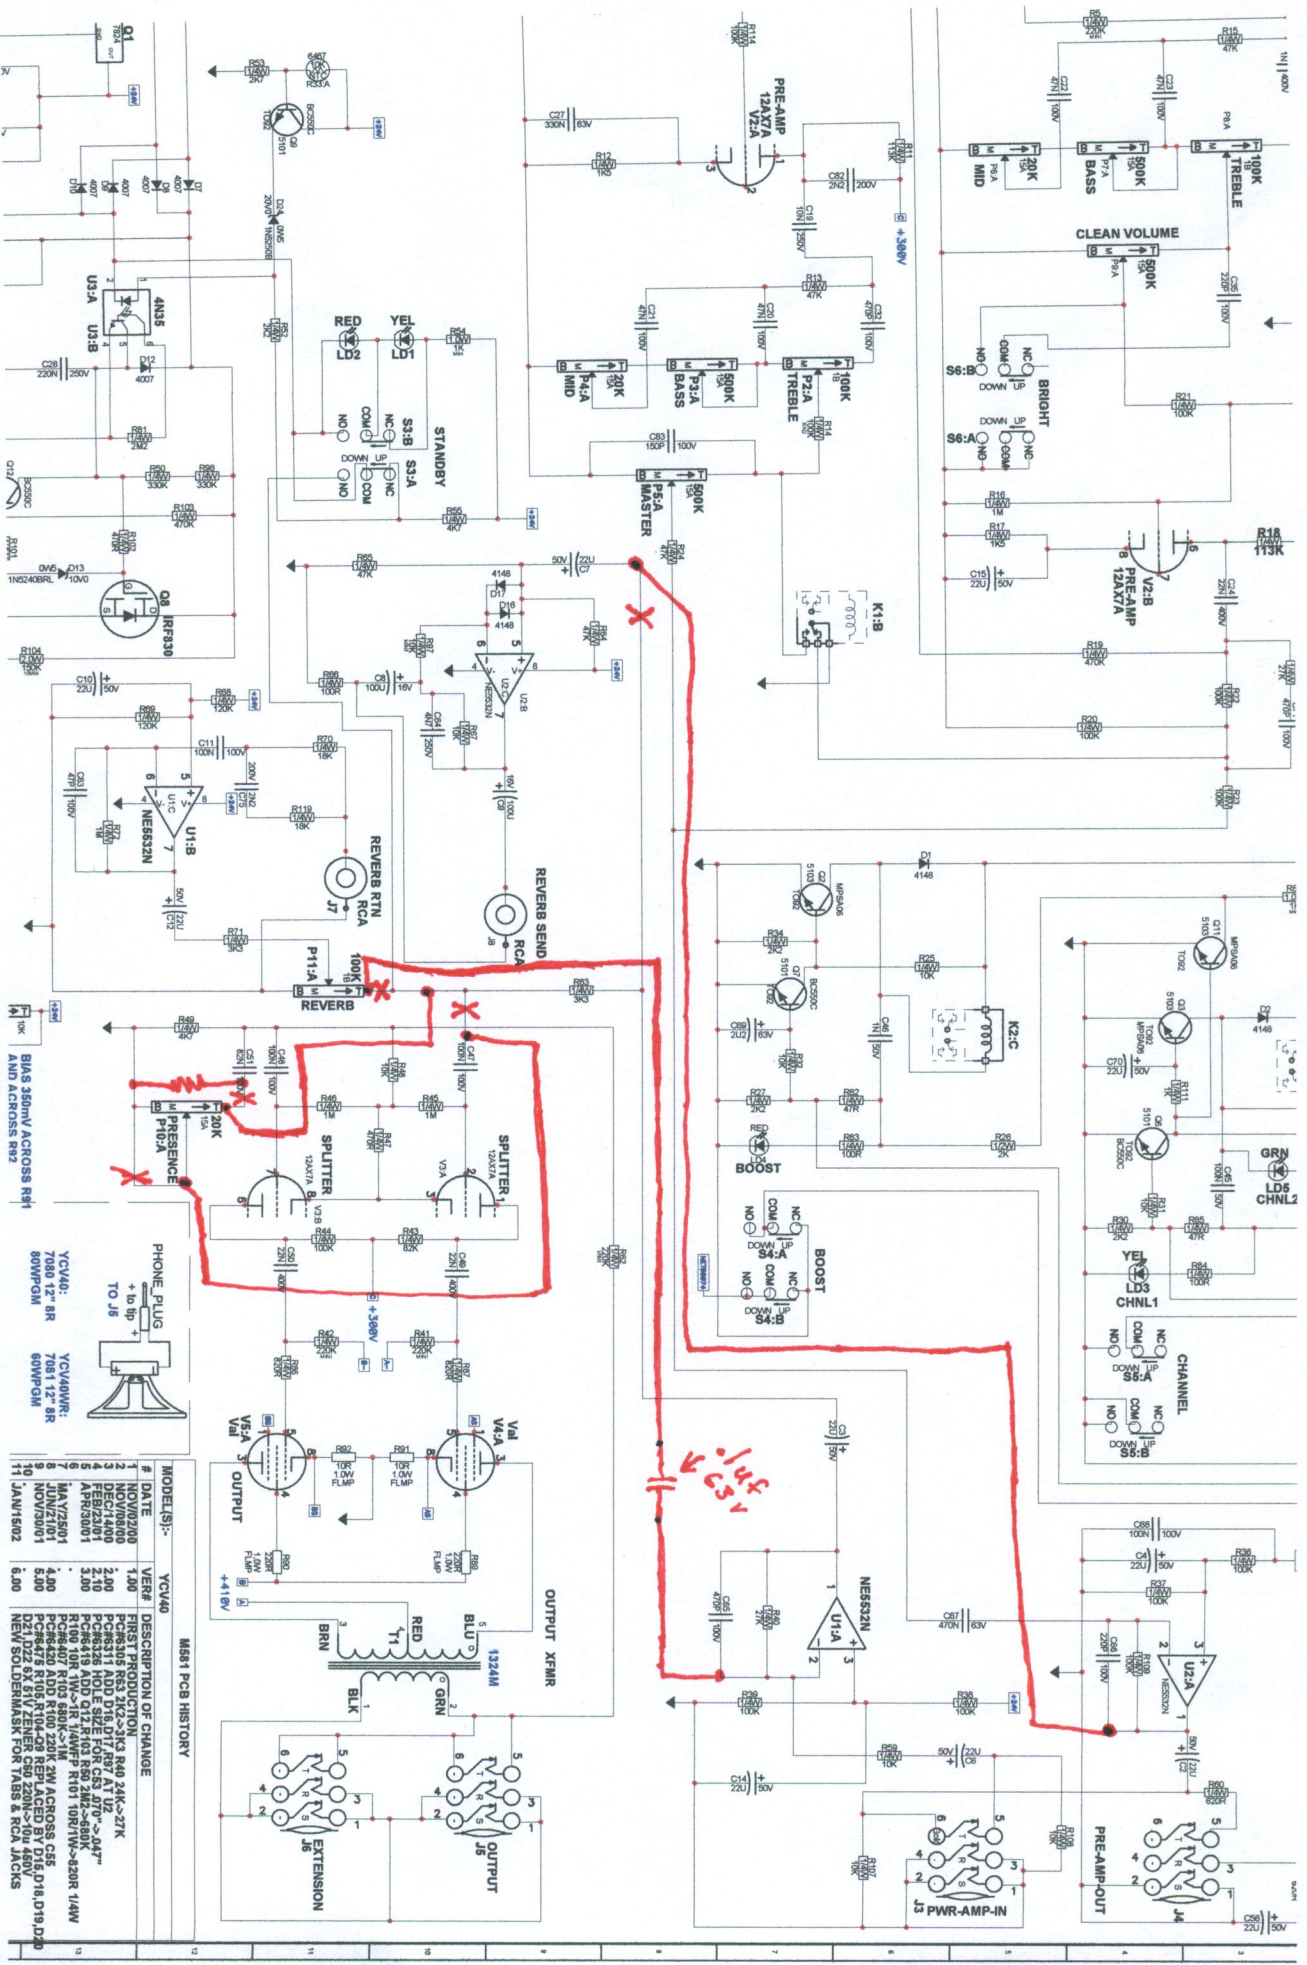

MS81 PCB HISTORY

MODEL(S)	VCV40		
#	DATE	VER#	DESCRIPTION OF CHANGE
1	NOV/08/2000	1.00	FIRST PRODUCTION
2	NOV/08/2000	1.10	PC#88309 R33 2K2->3K3 R40 2K4->27K
3	FEB/24/00	2.10	PC#88328 ADD R22 10K TO CA1 070->047"
4	FEB/24/00	2.40	PC#88328 ADD R22 10K TO CA1 070->047"
5	APR/20/01	3.00	PC#88419 ADD Q12 R103 R80 2M2->800K
6	MAY/25/01	4.00	R100 10K 1W->1R 1/4W/RP R101 10R/1W->820R 1/4W
7	JUN/27/01	4.00	PC#88420 ADD R104 220K REPLACED BY D15,D18,D19,D20
8	NOV/29/01	5.00	NZ1/D22 0.5W 5V ZENER 5V0 220V->10V 480V
9	JAN/15/02	5.00	NZ1/D22 0.5W 5V ZENER 5V0 220V->10V 480V
10	JAN/15/02	5.00	NZ1/D22 0.5W 5V ZENER 5V0 220V->10V 480V

X = lot traces on circuit board.